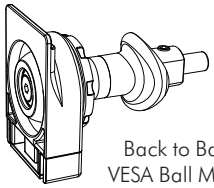# Installation Instructions
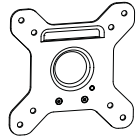
◈ spacedec

Display | POS Multi Back to Back

Component Checklist (Check you have received all parts against the Component Checklist below)

Back to Back
VESA Ball Mount

VESA plate (x1)

Tightening Tool (x1)

Hardware

M4x10mm Screws (x4)		3mm Allen Key
M4x12mm Screws (x4)		2mm Allen Key
M4x16mm Screws (x4)		Security Screw (x1)

Step 1. Preparation

Choose from one of the following options:

A. New POS Multi Back to Back Installation
Prior to installing a **new** POS Multi Back to Back Assembly, you will need to:
- Install a POS Multi product to the work surface (refer to the POS Multi Installation Instructions).
- Remove the Top Cap (use a small screw driver).

OR

B. Back to Back Conversion
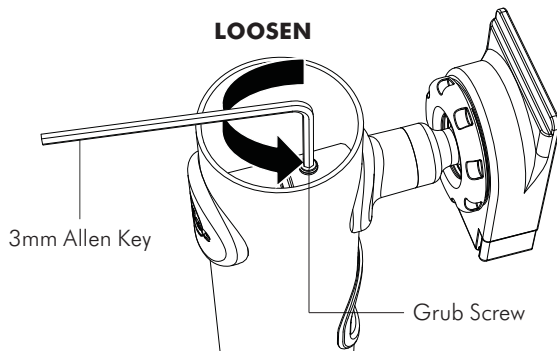Prior to converting an **existing** POS Multi Assembly, you will need to:
- Remove the existing Display (TV/Monitor).
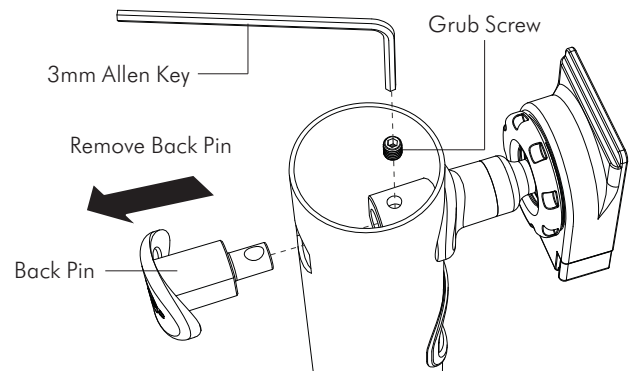- Remove the Top Cap (use a small screw driver).

Top Cap

Top Cap

TIP: Be careful not to damage the Top Cap.

Existing POS Multi Assembly
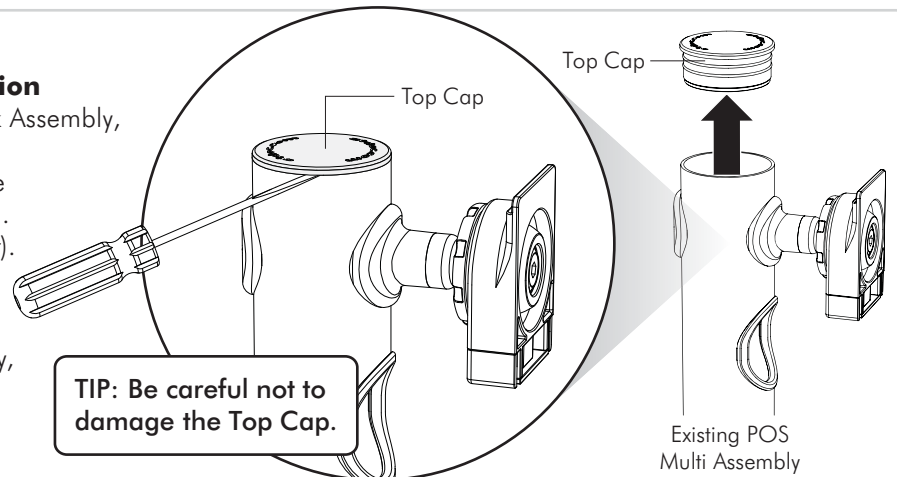
Step 2. Undo and Remove Back Pin

Using the 3mm Allen Key, undo the Grub Screw
NOTE: This will be very tight

LOOSEN

3mm Allen Key

Grub Screw

Remove the Back Pin but keep the Grub Screw for use later on.

3mm Allen Key

Grub Screw
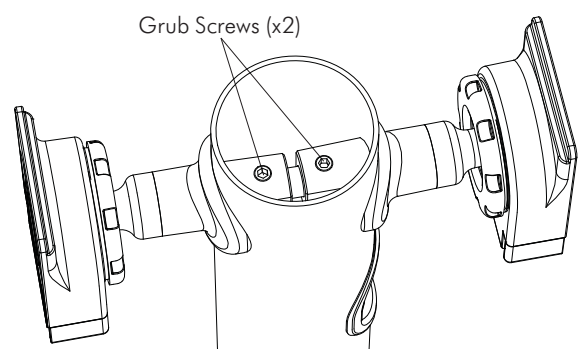
Remove Back Pin

Back Pin

Step 3. Install Back to Back VESA Ball Mount

Use the Grub Screw to Install the Back to Back VESA Ball Mount. Ensure the Recess (shown) lines up with the Grub Screw before tightening.
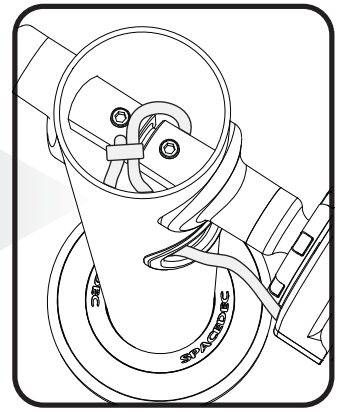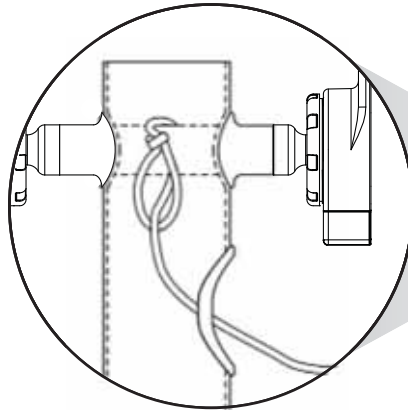
3mm Allen Key

TIGHTEN

Back to Back VESA Ball Mount

Recess
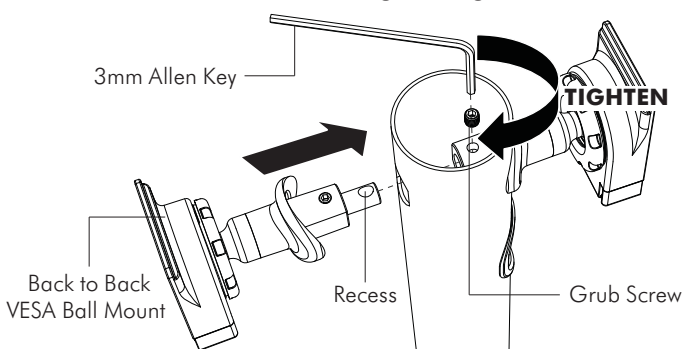
Grub Screw

Ensure both Grub Screws are tightened as firmly as possible.
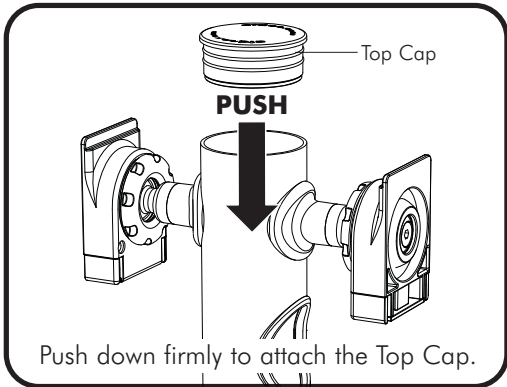
Grub Screws (x2)

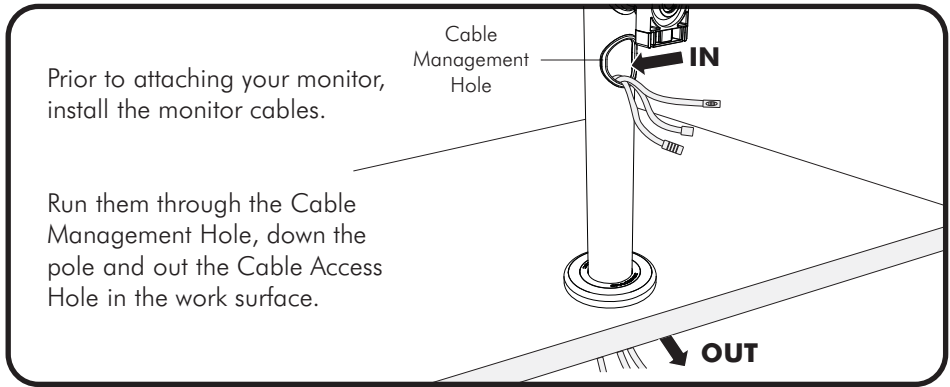## Step 4. (Optional) Install Monitor Security Cable (Security Cable NOT Included)

A. Loop the Security Cable (Kensington or similar) around the internal post of the POS Assembly.

B. Feed the other end of the cable through the POS Assembly and out the Cable Management Hole.

C. After you have attached the monitor (as directed in **Step 8**) install the lock to the monitor as per the manufacturer guidelines.

Step 5. Install Top Cap

Top Cap

PUSH

Push down firmly to attach the Top Cap.

Step 6. Install Monitor Cables

Prior to attaching your monitor, install the monitor cables.

Run them through the Cable Management Hole, down the pole and out the Cable Access Hole in the work surface.
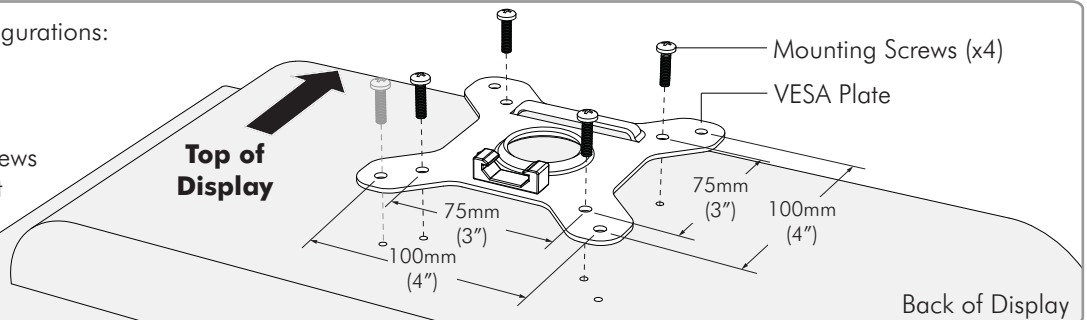
Cable Management Hole

IN

OUT

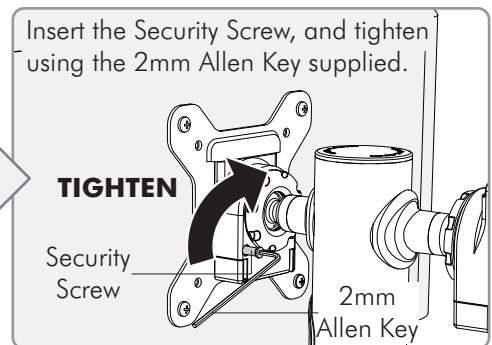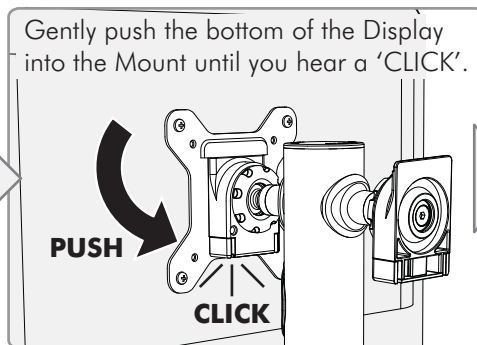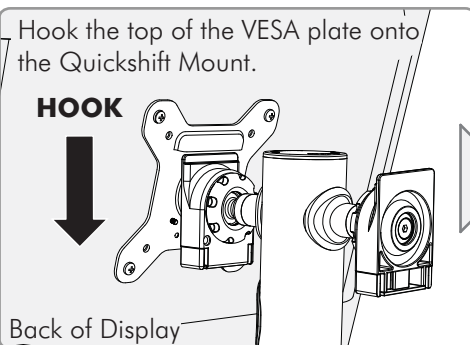## Step 7. Attach the VESA plate to your Display

There are two mounting hole configurations:
• 75 x 75mm
• 100 x 100mm

Choose appropriate Mounting Screws from the Hardware supplied to suit your Display.

Top of Display

Mounting Screws (x4)

VESA Plate

75mm (3")
100mm (4")

75mm (3")
100mm (4")

Back of Display

Step 8. Attach your Display to the POS Multi Assembly (Repeat for both Displays)

Hook the top of the VESA plate onto the Quickshift Mount.

HOOK

Back of Display

Gently push the bottom of the Display into the Mount until you hear a 'CLICK'.

PUSH

CLICK

Insert the Security Screw, and tighten using the 2mm Allen Key supplied.

**TIGHTEN**

Security Screw

2mm Allen Key

Step 9. Adjust the VESA Ball Mount

Poistion your Display to the desired viewing angle, using the 40° angular movement allowed by the VESA Ball Mount.

If the display does not hold its position, or is too resistant, adjust the Tension Plate (see diagram right).

To make any adjustments, use the Tightening Tool supplied.

Tension Plate

Loosen (-Kg)

Tightening Tool

Tighten (+Kg)
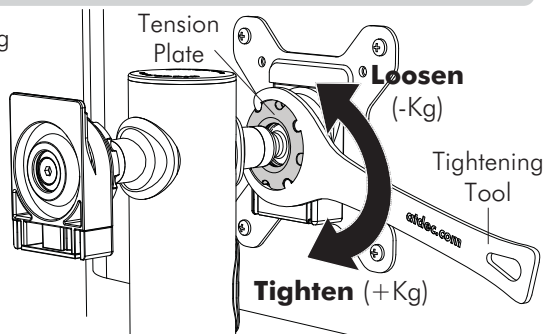
Advanced Security Installation

These Installation Instructions secure the POS Multi using the provided fasteners from above the work surface.

For advanced Security Installation from below the work surface. Please refer to the *Advanced Security Installation Addendum*.

atdec